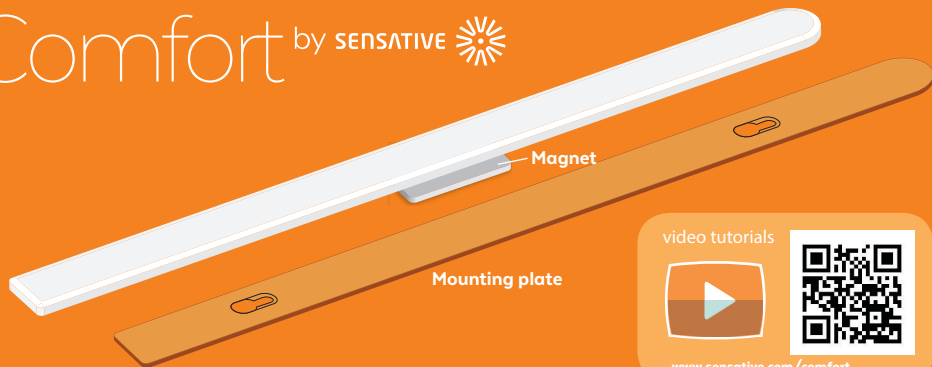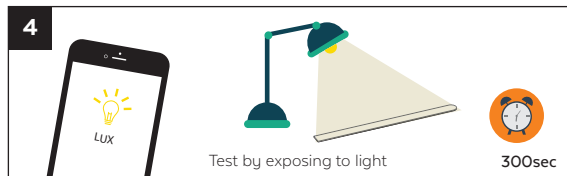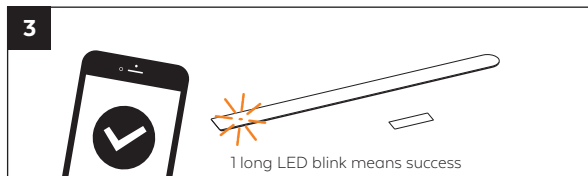# Strips Comfort by SENSATIVE
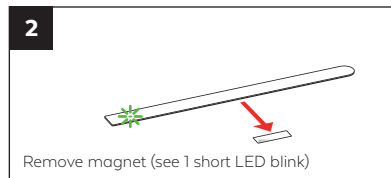
Temperature & Light Sensor

Z WAVE PLUS

Magnet

Mounting plate

1

ADD +

Put gateway into add mode

2

Remove magnet (see 1 short LED blink)

3

1 long LED blink means success

4

LUX

Test by exposing to light

300sec

ALT. A (5-6)

A 5

Remove adhesive

A 6

Mount Strips
To wall

✔

OR

ALT. B (5-9)

B 5

Use the plate to
mark screw holes

B 6

Drill using 4mm
bit, then mount
screws to surface

ø.4mm

B 7

Remove adhesive

B 8

Apply to mounting plate

STRIPS
SIDE

B 9

Hang Strips on screws
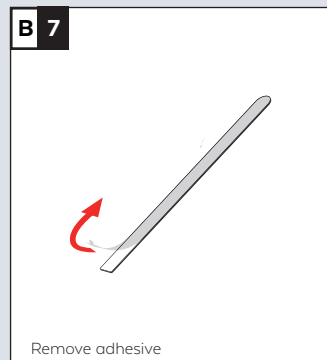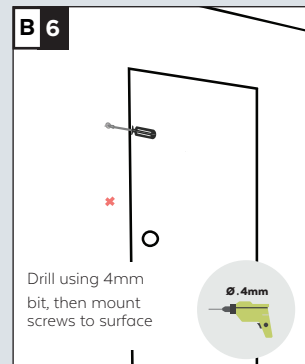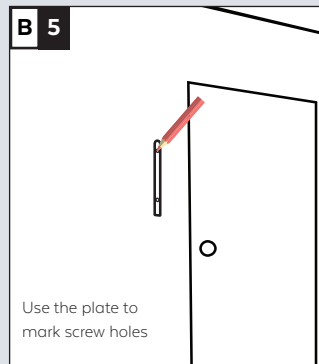
✔
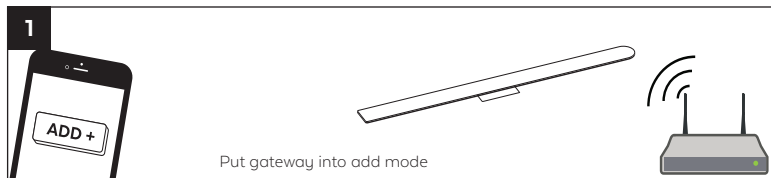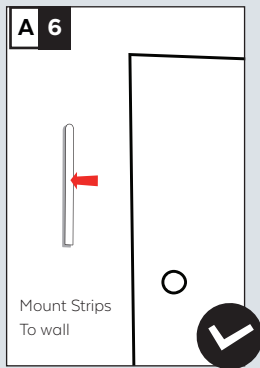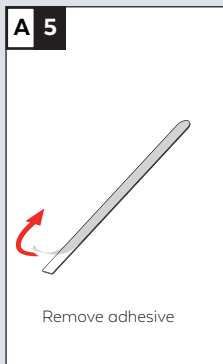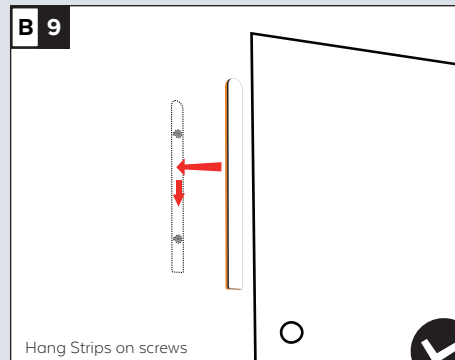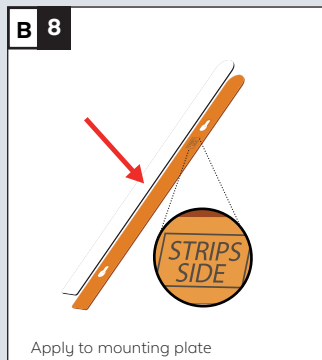
SENSATIVE STRIPS COMFORT ILLUSTRATIONS MANUAL

Colors used:
PANTONE 151C - Orange, background first spread
PANTONE 150C - Light orange, box behind QR code
CMYK - All other details
Black

Coating on all surfaces: Matte UV Coating